



**Aalto University
School of Electrical
Engineering**

Lecture 5: Sensorless Flux Estimation and Direct Torque Control (DTC)

ELEC-E8402 Control of Electric Drives and Power Converters

Marko Hinkkanen

Spring 2021

Learning Outcomes

After this lecture and exercises you will be able to:

- ▶ Explain typical properties of sensorless control
- ▶ Explain the operating principle of direct torque control (DTC), including the switching logic in normal operation


The induction motor drive is considered in this lecture, but the methods can be modified for synchronous motors as well.

Sensorless Vector Control of an Induction Motor

Direct Torque Control

Example: Sensorless Control System for an Induction Motor

- ▶ Dead-time effect and power-device voltage drops are compensated for in the PWM
- ▶ Torque and speed controllers are similar to those in sensed drives
- ▶ Stability and performance depend on the flux estimator

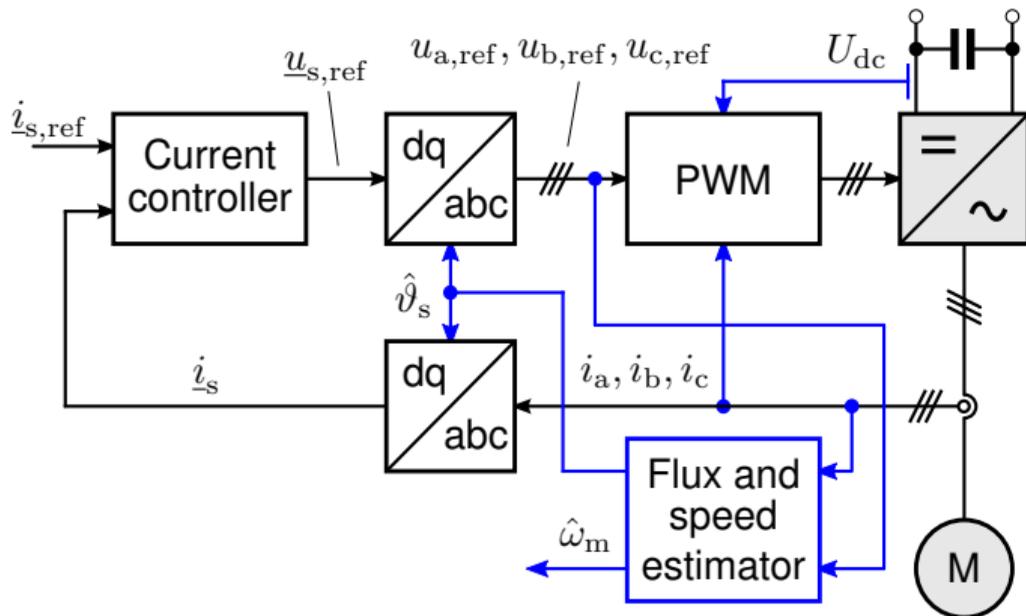

The inverter nonlinearities can be approximately compensated for as $u'_{a,ref} = u_{a,ref} + \Delta u \text{sign}(i_a)$, where $u'_{a,ref}$ is the compensated voltage reference and Δu is the compensation magnitude (typically a few volts). The compensation is used for the b- and c-phases as well.

Voltage-Model Flux Estimator in Stator Coordinates

- ▶ Stator voltage equation is simulated in real time

$$\frac{d\hat{\underline{\psi}}_s^s}{dt} = \underline{u}_s^s - \hat{R}_s \underline{i}_s^s \quad \text{or} \quad \hat{\underline{\psi}}_s^s = \int \left(\underline{u}_s^s - \hat{R}_s \underline{i}_s^s \right) dt$$

- ▶ Pure integration: $\hat{\underline{\psi}}_s^s$ does not appear on the right-hand side
- ▶ Rotor flux estimate is obtained using the flux equation

$$\hat{\underline{\psi}}_R^s = \hat{\underline{\psi}}_s^s - \hat{L}_\sigma \underline{i}_s^s$$

- ▶ Estimated rotor flux angle

$$\hat{\vartheta}_s = \text{atan2} \left(\hat{\psi}_{R\beta}, \hat{\psi}_{R\alpha} \right)$$

- ▶ Alternatively could be implemented in estimated rotor flux coordinates

Properties of the Voltage Model

- ▶ Speed sensor is not needed
- ▶ Very sensitive to \hat{R}_s at low speeds (depends also on \hat{L}_σ)
- ▶ Good accuracy at higher speeds (despite the parameter errors)
- ▶ Pure integration does not work in practice since the flux estimate will drift away from the origin (due to any offsets in measurements)
- ▶ Above problems can be partly solved using more advanced flux observers¹

¹Hinkkanen, Harnefors, and Luomi, "Reduced-order flux observers with stator-resistance adaptation for speed-sensorless induction motor drives," *IEEE Trans. Power Electron.*, 2010.

Speed Estimation

- ▶ If the voltage-model based flux observer is used, the rotor speed can be estimated using the **slip relation** in estimated rotor flux coordinates

$$\hat{\omega}_m = \hat{\omega}_s - \hat{\omega}_r = \hat{\omega}_s - \frac{\hat{R}_R i_q}{\hat{\psi}_R}$$

- ▶ Angular speed of the rotor flux vector

$$\hat{\omega}_s = \frac{d\hat{\vartheta}_s}{dt}$$

- ▶ Low-pass filtering of $\hat{\omega}_m$ is typically needed

Sensorless Control: Problems and Properties


- ▶ Flux estimation at lowest speeds is difficult
- ▶ Error sources in the flux estimation
 - ▶ Parameter errors (\hat{R}_s is crucial at low speeds)
 - ▶ Errors in the stator voltage: inverter nonlinearities are typically compensated for but some error remains
- ▶ Sustained operation at zero stator frequency is not possible (under the load torque)
- ▶ Most demanding applications still need a speed sensor

Sensorless Vector Control of an Induction Motor

Direct Torque Control

Direct Torque Control: Introduction^{2,3}

- ▶ **Instantaneous values** of the stator flux and torque are controlled directly by means of inverter switching states
 - ▶ Hysteresis control principle
 - ▶ Stator coordinates
 - ▶ No separate PWM
 - ▶ Typical sampling period $12.5 \mu\text{s}$ (80 kHz)
- ▶ Torque can be controlled at fastest possible rate of change without overshoot (ideally)

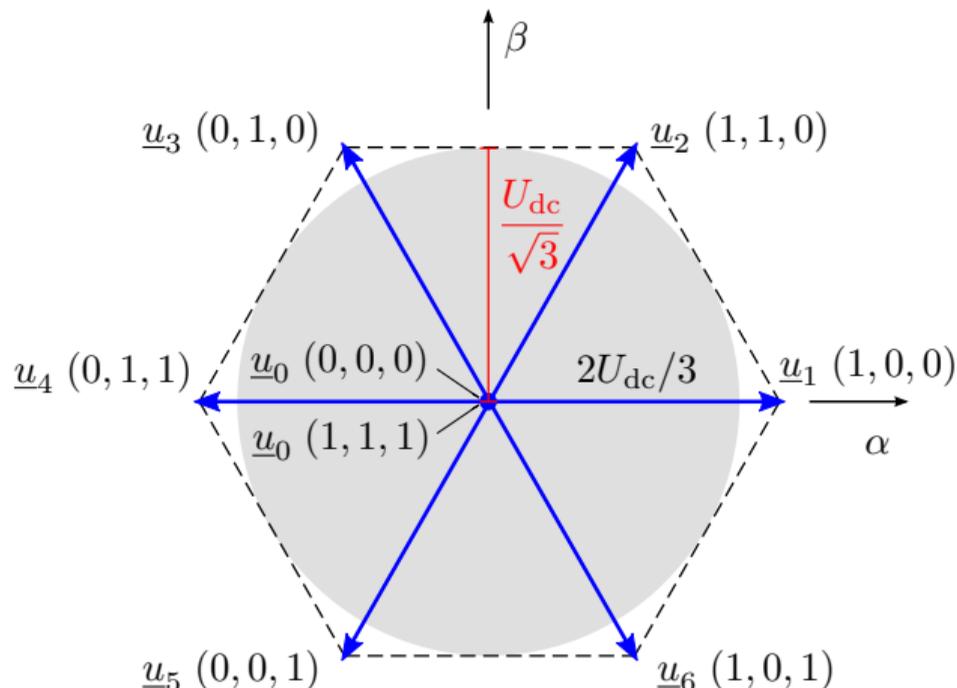

²Takahashi and Noguchi, "A new quick-response and high-efficiency control strategy of an induction motor," *IEEE Trans. Ind. Appl.*, 1986.

³Depenbrock, "Direct self-control (dsc) of inverter-fed induction machine," *IEEE Trans. Power Electron.*, 1988.


Control Principle

- ▶ Suitable voltage vector \underline{u}_n (where $n = 0 \dots 6$) is selected at each sampling period
- ▶ Change in the stator flux

$$\Delta \underline{\psi}_s^s = \int_0^{\Delta t} (\underline{u}_s^s - R_s \underline{i}_s^s) dt \approx \underline{u}_n \Delta t$$

where Δt is multiple of the sampling period

- ▶ Which voltage vectors are applied in the figure?

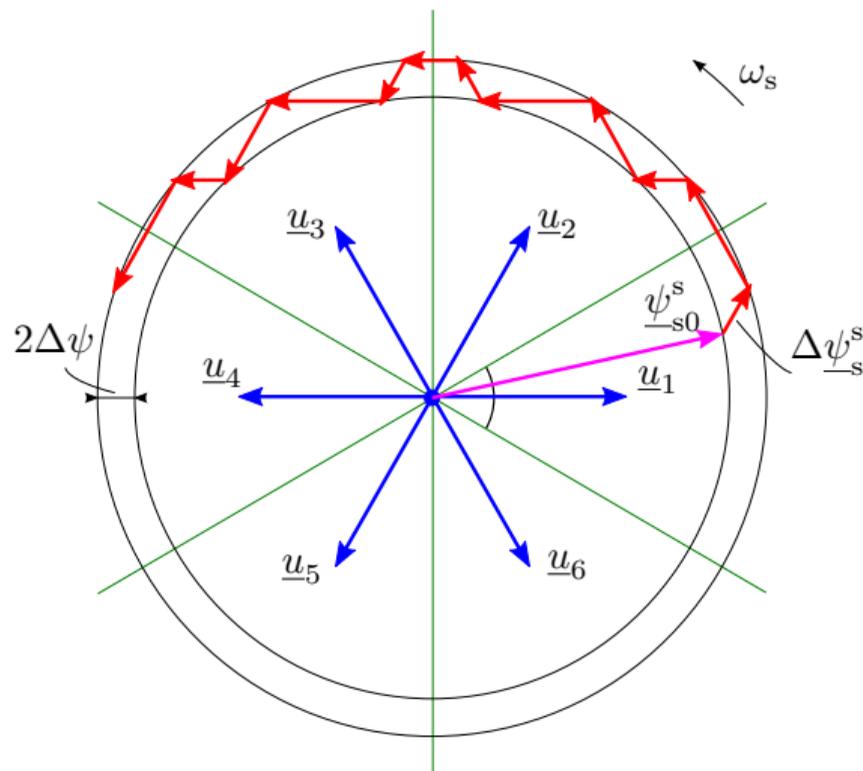



- ▶ Torque depends on ϑ_{ψ_s}

$$T_M = \frac{3p}{2} \frac{1}{L_\sigma} \operatorname{Im} \left\{ \underline{\psi}_{-R}^* \underline{\psi}_{-s} \right\}$$


$$= \frac{3p}{2} \frac{1}{L_\sigma} \psi_R \psi_s \sin(\vartheta_{\psi_s} - \vartheta_{\psi_R})$$

- ▶ Rotor flux vector $\underline{\psi}_{-R}^s$ is almost constant during a very short sampling period
- ▶ Torque can be changed via ϑ_{ψ_s}



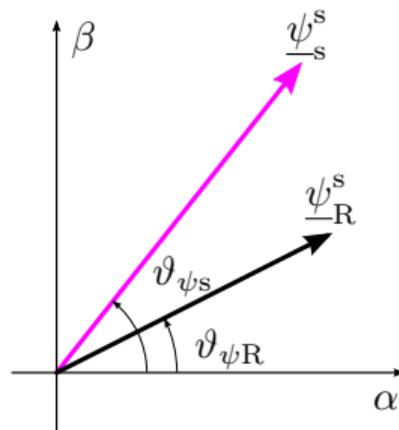


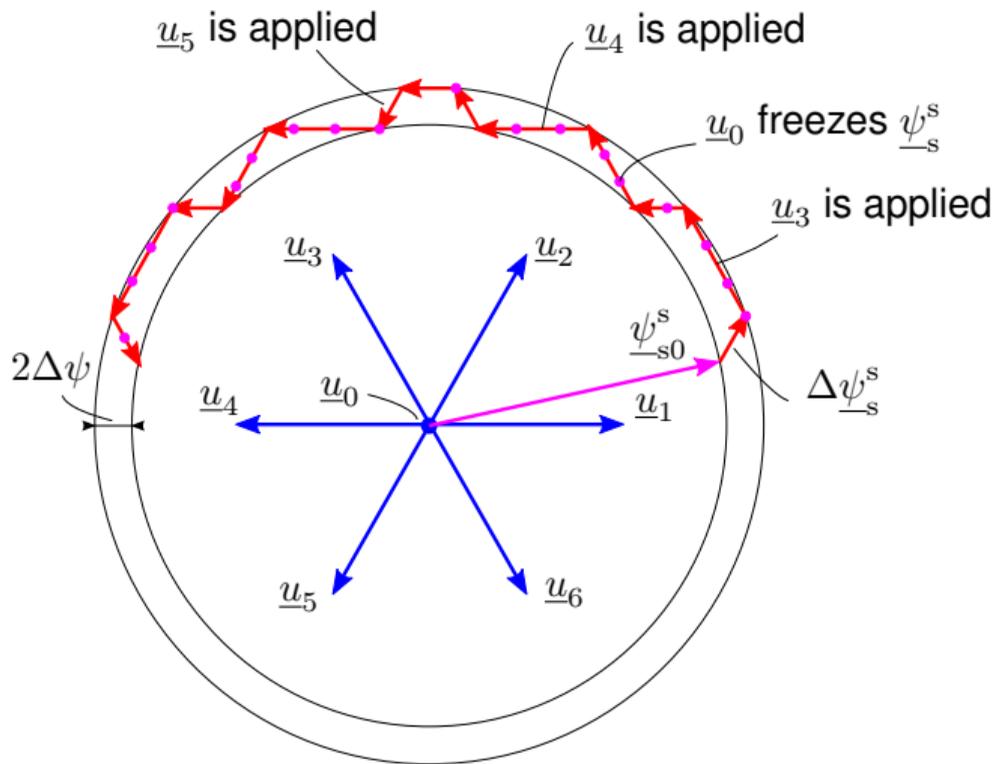

Six Sectors: Selection of Vectors in Sector 1

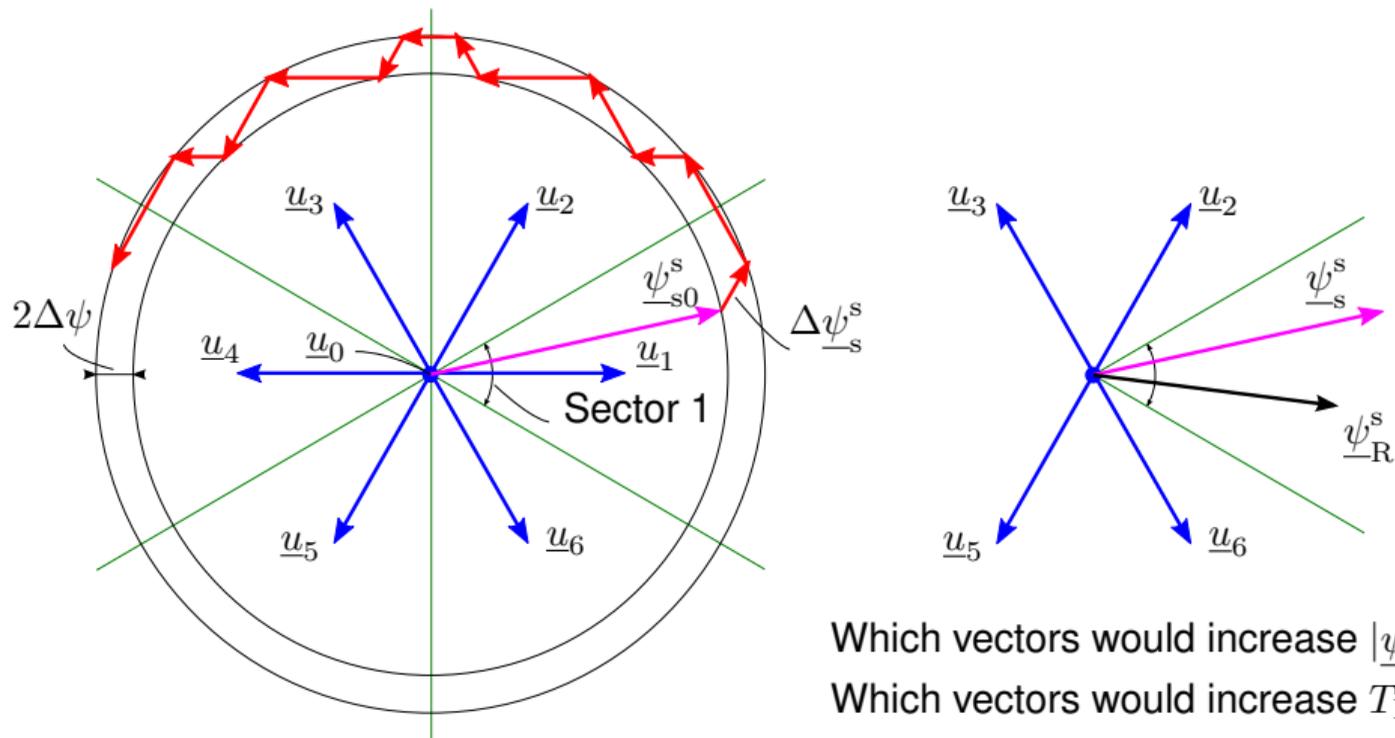

Control System

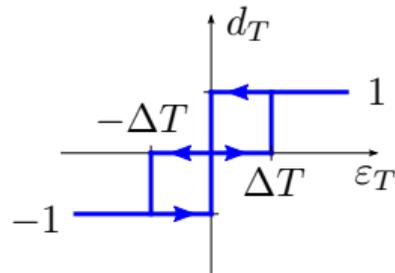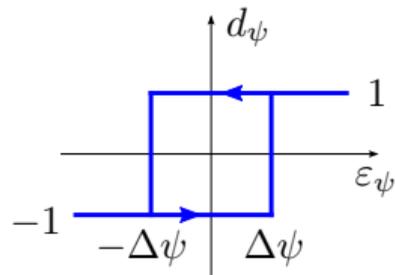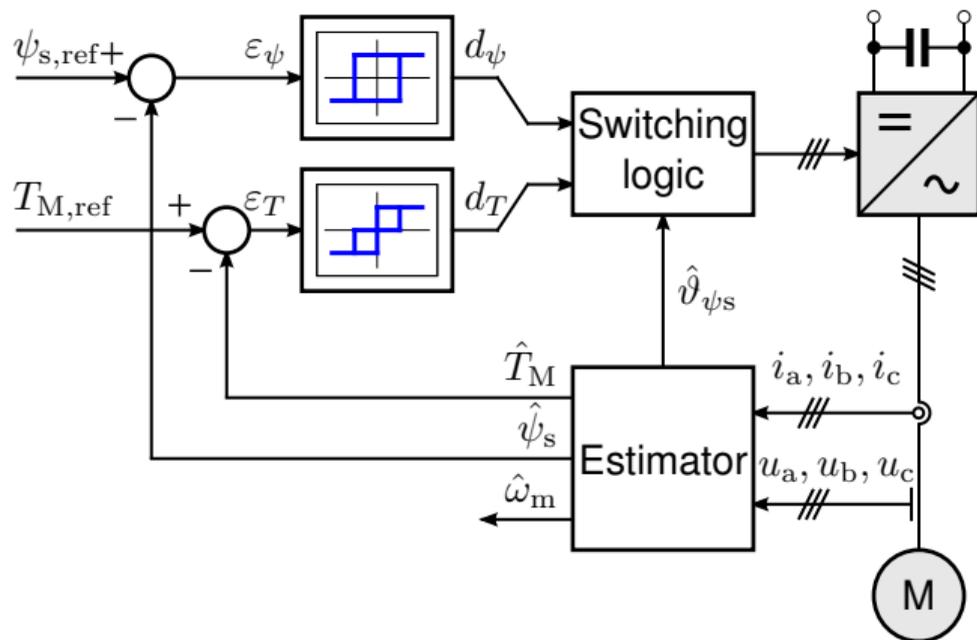


Principle of the Switching Logic

- Hysteresis flux controller

$$d_{\psi}(k) = \begin{cases} -1 & \text{if } \varepsilon_{\psi}(k) < -\Delta\psi \\ 1 & \text{if } \varepsilon_{\psi}(k) > \Delta\psi \\ d_{\psi}(k-1) & \text{otherwise} \end{cases}$$

- Hysteresis torque controller can be implemented similarly
- Switching logic in Sector 1

d_T	1	1	0	0	-1	-1
d_{ψ}	1	-1	1	-1	1	-1
Vector	\underline{u}_2	\underline{u}_3	0	0	\underline{u}_6	\underline{u}_5

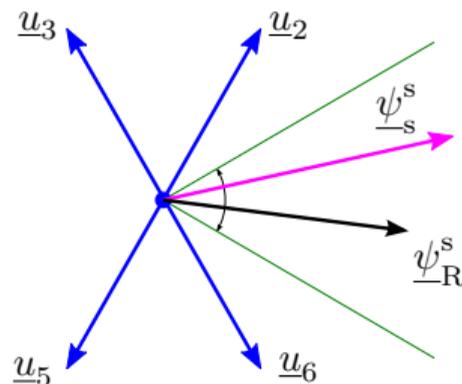

Stator Flux and Torque Estimation

- ▶ Voltage-model estimator can be used

$$\frac{d\hat{\psi}_s^s}{dt} = \underline{u}_s^s - \hat{R}_s \underline{i}_s^s$$

- ▶ Similar problems (and their remedies) as in sensorless vector control
- ▶ Torque estimate

$$\hat{T}_M = \frac{3p}{2} \text{Im} \left\{ \underline{i}_s^s \hat{\psi}_s^{s*} \right\}$$

Properties of DTC

- ▶ Fast dynamic response can be achieved
- ▶ Switching frequency varies with the operating point and motor parameters
- ▶ Hysteresis control requires a high sampling frequency and computing speed in order to detect when the flux or the torque gets outside the hysteresis band
- ▶ Flux estimation at low speeds without the speed sensor can be a difficult problem (the same problem also in sensorless vector control)
- ▶ DTC can be modified for synchronous motors